

## Technical bulletin:


Updating AGCO RG-C Series sprayers to CapView Software version 4.18 requires a modification to the Chassis Harness PN 118669-050

Not all machines properly operating in the field require this update. All systems shipped to AGCO after October 1st 2018 will have the harness modification and software installed. For instructions on field-updating to CapView software version 4.18, visit [www.capstanag.com/pinpoint-ii](http://www.capstanag.com/pinpoint-ii)


Part numbers needed for this update are:

Part Number	Description	Quantity
706530-312	Deutsch 12-pin DT male connector- A-keyed	1
706530-322	Deutsch 12-pin DT male wedgelock	1
706530-346	Deutsch DT white terminal plug	12


1. Make sure the machine is powered off and that the battery disconnect has been tripped.
2. Remove the cover from the Gateway hub.
3. On the Gateway Hub, remove the 12-pin Deutsch connector in the DIGITAL port.

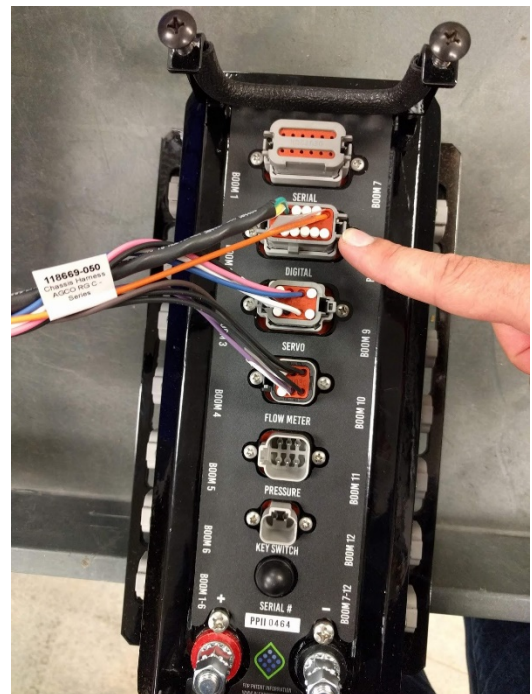


4. Remove the wedge lock from the male connector on the harness side.
5. Remove the orange wire from the connector.
6. Replace the open hole with a white Deutsch plug and insert the wedge lock.
7. Install the connector into the DIGITAL port on the Gateway Hub.

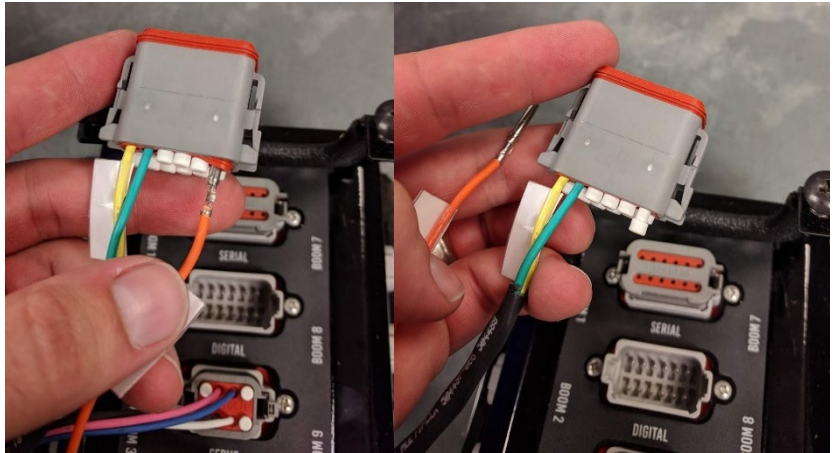

8. Take a 12-pin Deutsch DT male connector and install the orange wire into the pin-6 location and plug all other pin locations.

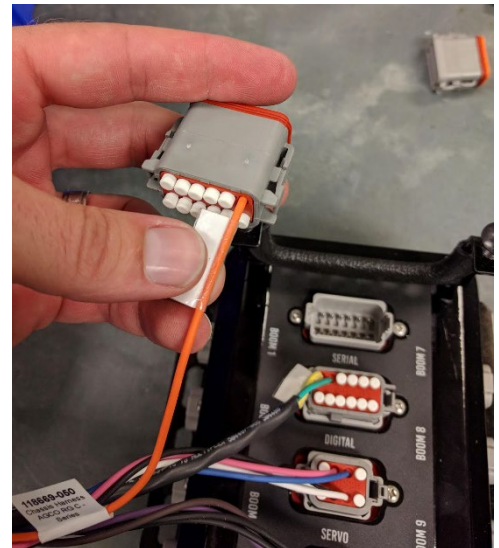

9. Remove the 12-pin plug from the SERIAL port on the Gateway Hub.

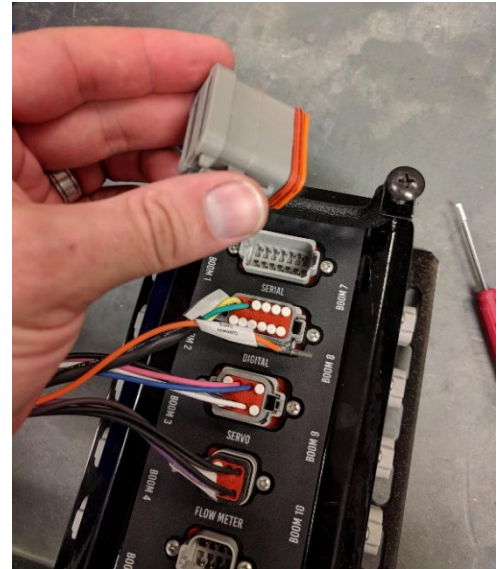

10. Insert the male connector with the orange wire into the SERIAL port.
11. Replace the cover on the Gateway Hub.

